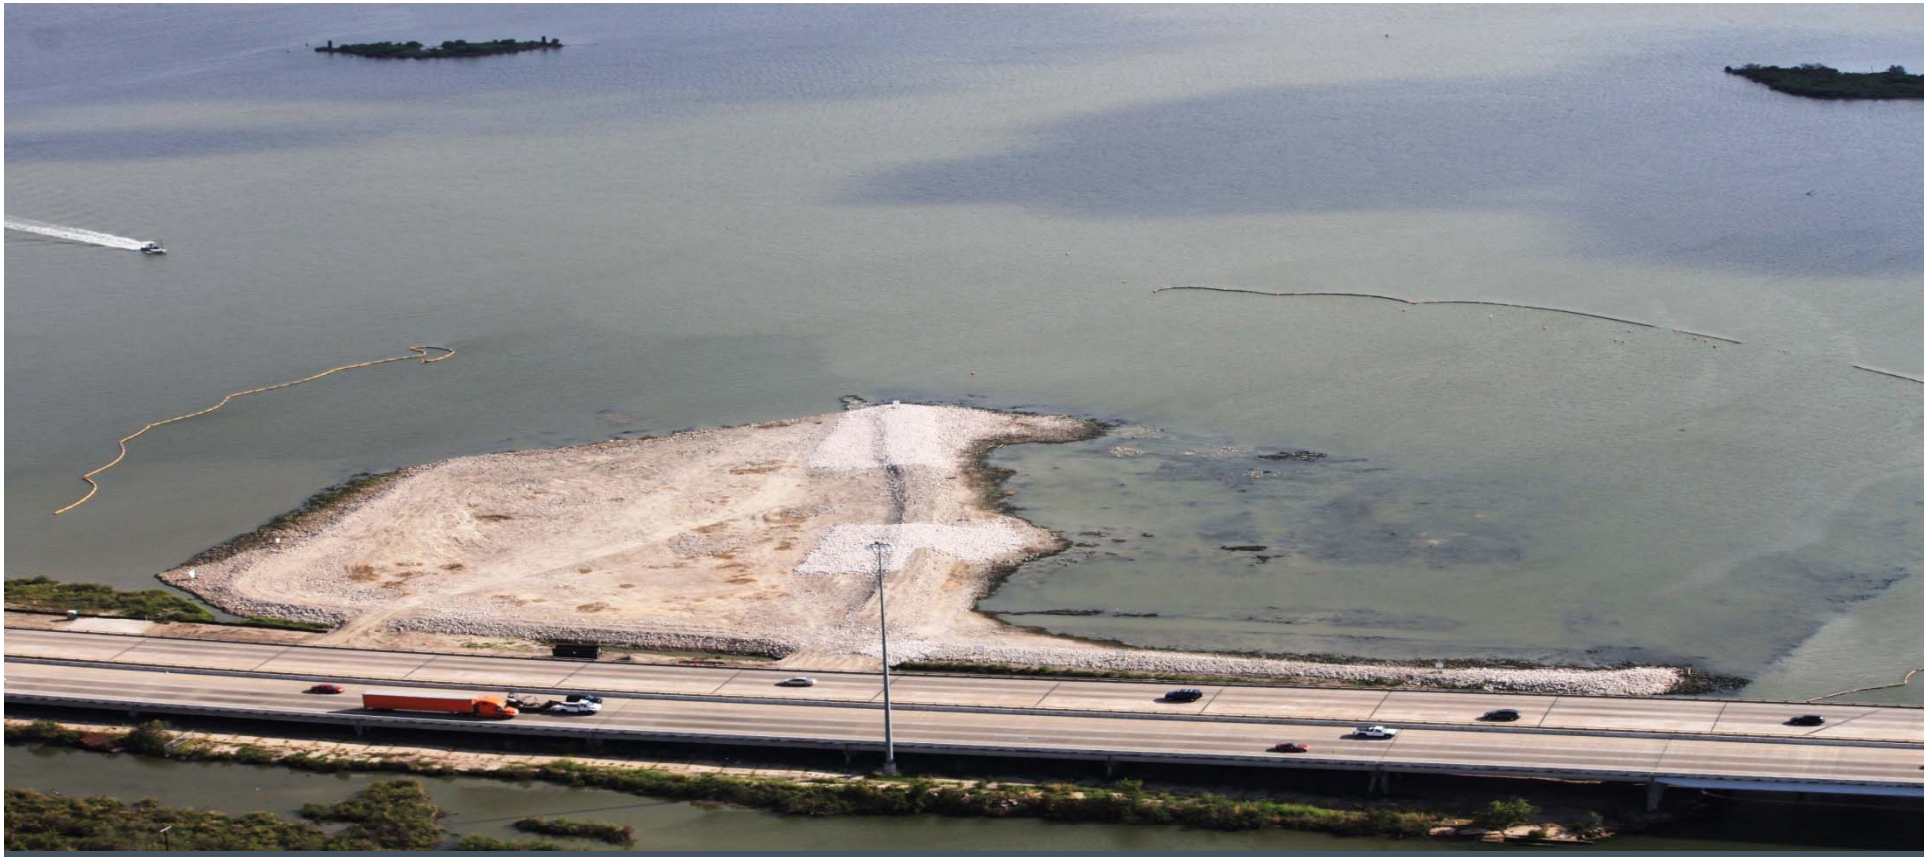

San Jacinto River Waste Pits Superfund Site Overview

September 22, 2011

DRAFT – Do Not Quote or Cite

ANCHOR QEA

Location

VICINITY MAP

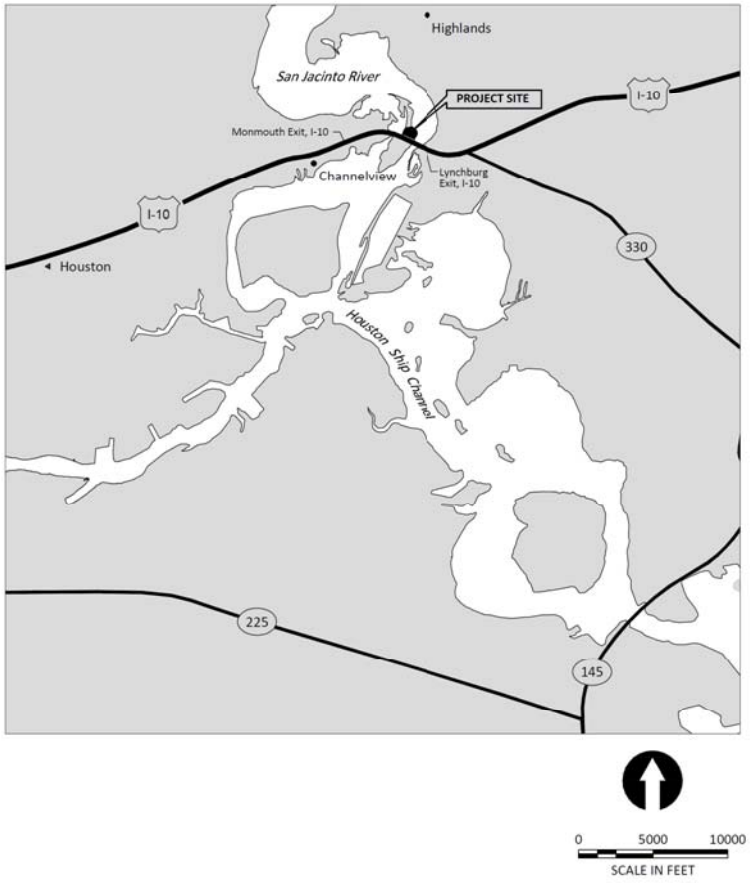

SITE MAP

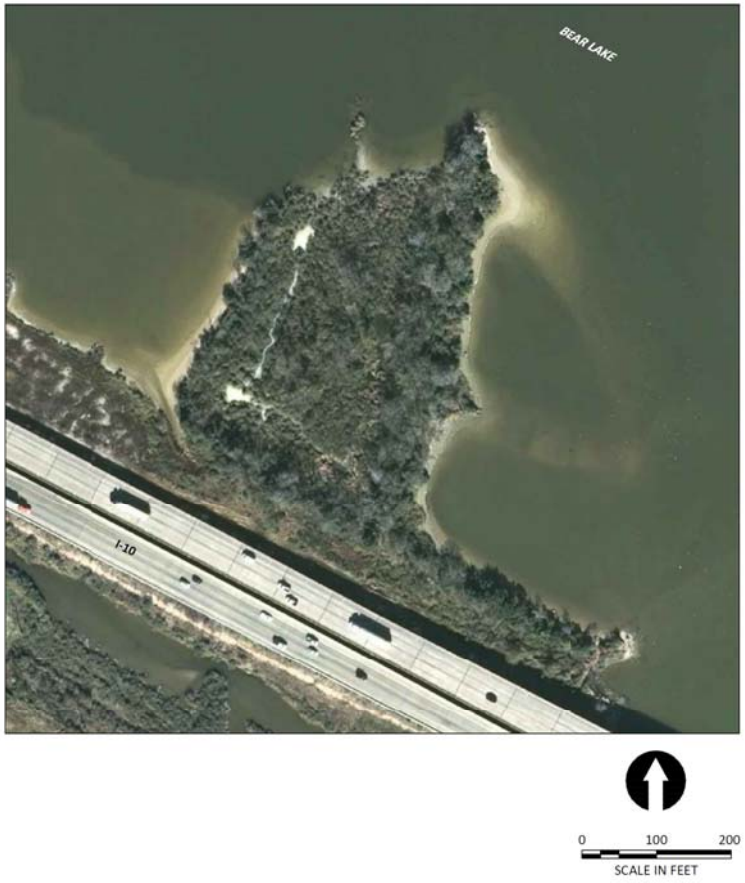

ANCHOR QEA

Site History

- Impoundments, built in the mid-1960s for disposal of paper mill wastes
- Total area within berms is approximately 15.7 acres

ANCHOR QEA

Site History (continued)

- After construction, impoundments to the were affected by subsidence and dredging activities

ANCHOR QEA

January, 2002

ANCHOR QEA

Pre-Superfund Milestones

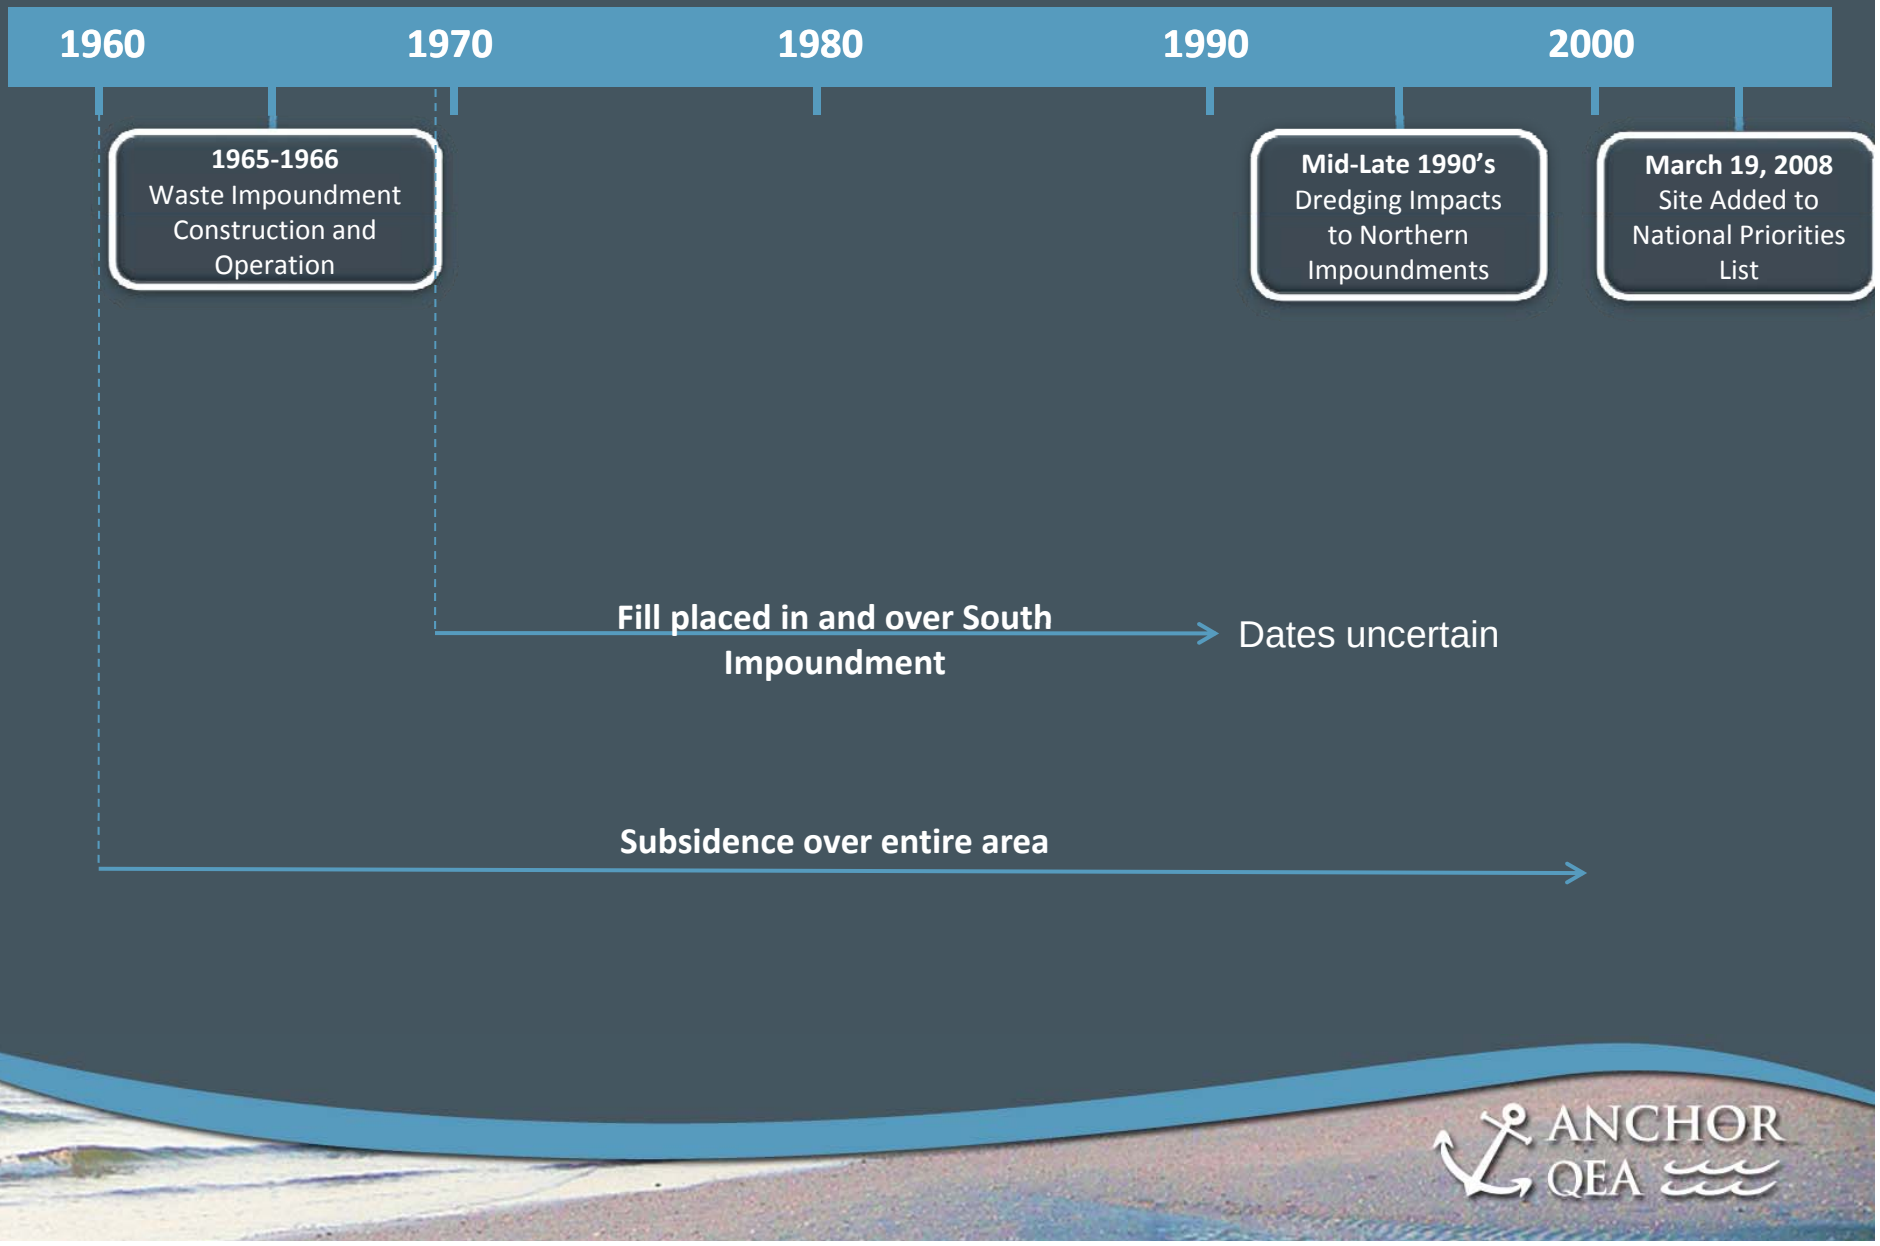

ANCHOR QEA

Superfund Timeline and Activities

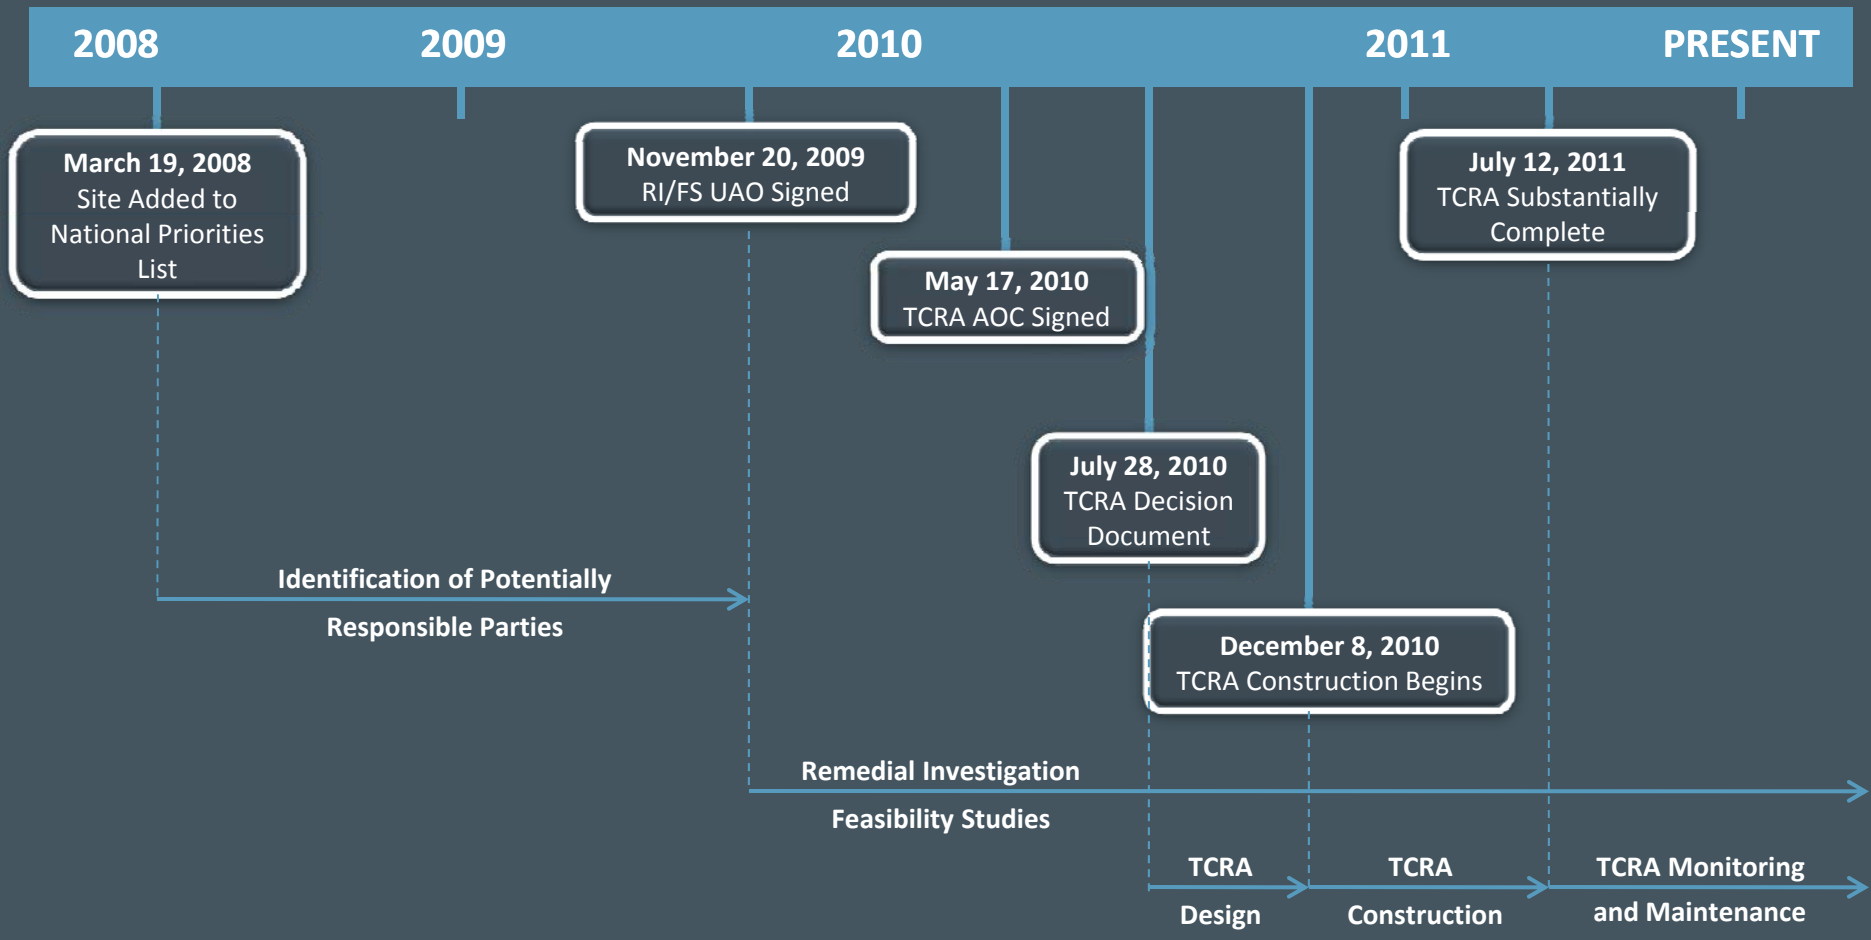

ANCHOR QEA

Site Stabilization (TCRA) Design Objectives

- Stabilize source materials within the original 1966 berm footprint with concentrations at or above 4.5 ng/kg TCDD
- Be capable of withstanding forces generated by the river in a 100 year storm event
- Prevent direct human and aquatic life contact with the waste materials.
- Be consistent with potential long-term remediation strategies that could be developed for the Site

ANCHOR QEA

Site Stabilization Construction Elements

- Site Fencing
- Signs
- Clearing and Site Preparation
  - TxDOT right-of-way improvements
  - Clearing impoundments
  - Off-site stockpile and loading area preparation
- Waterside placement of geotextile and protective capping materials
- Landside placement of geotextile, geomembrane and protective capping materials

ANCHOR QEA

Site Fencing and Access

ANCHOR QEA

Site Fencing

Completed Fence Installation South of I-10

Southwest Corner of Big Star Property Fence Installation

ANCHOR QEA

Access Road

Before

After

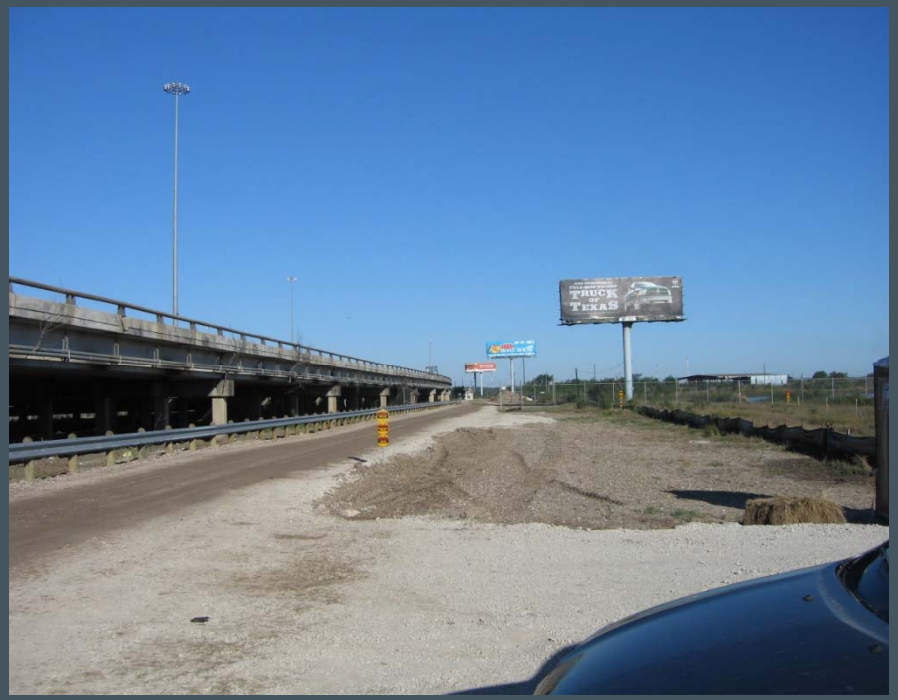

ANCHOR QEA

Armored Cap Sizing

Predicted 10 year flow velocities

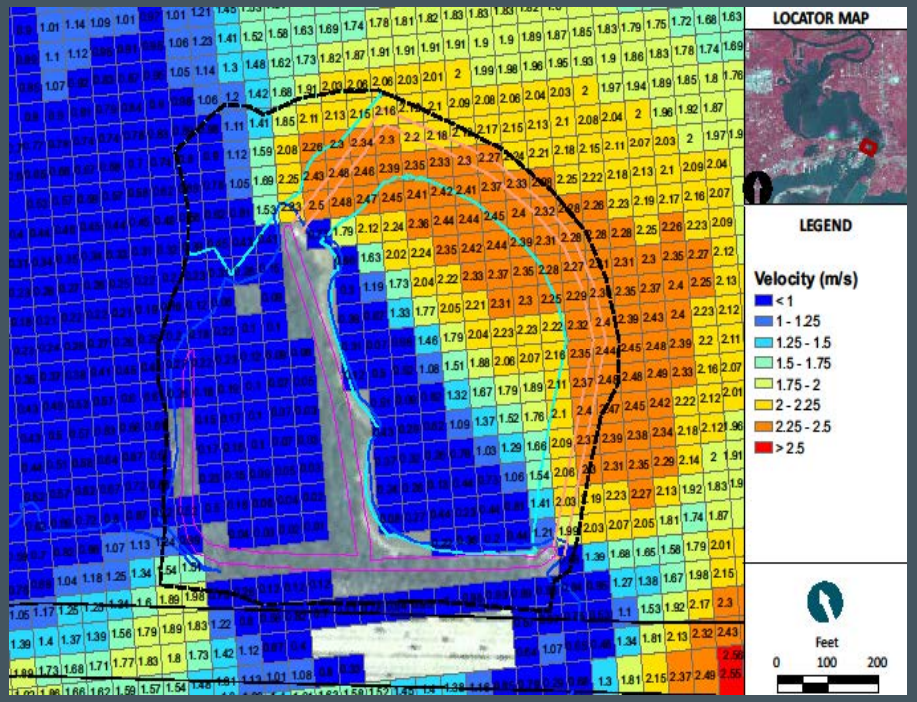

Predicted 100 year flow velocities

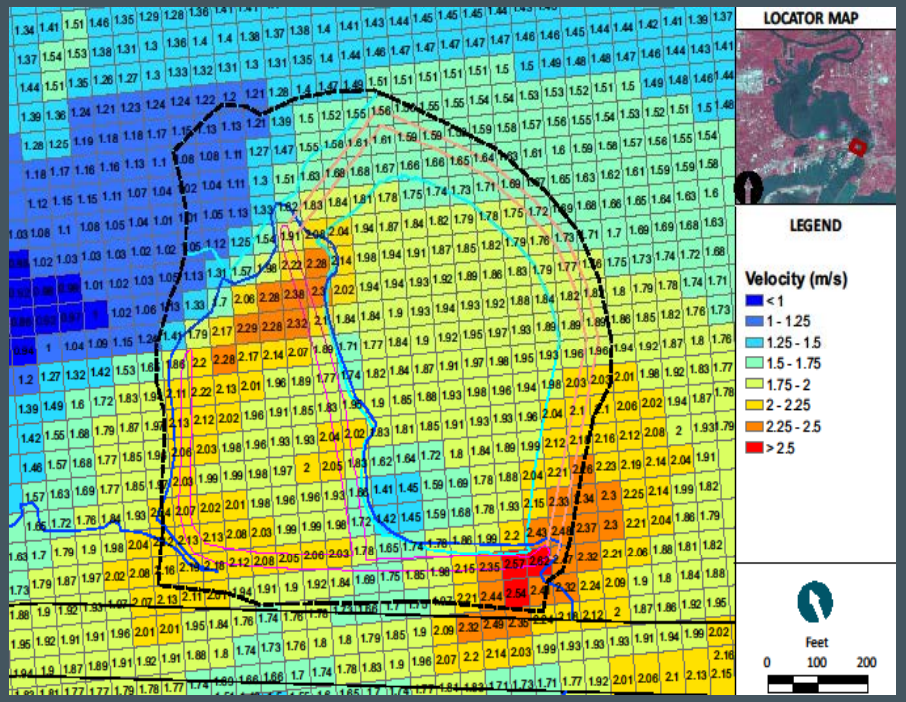

ANCHOR QEA

Construction Plans - Armor Cap Areas

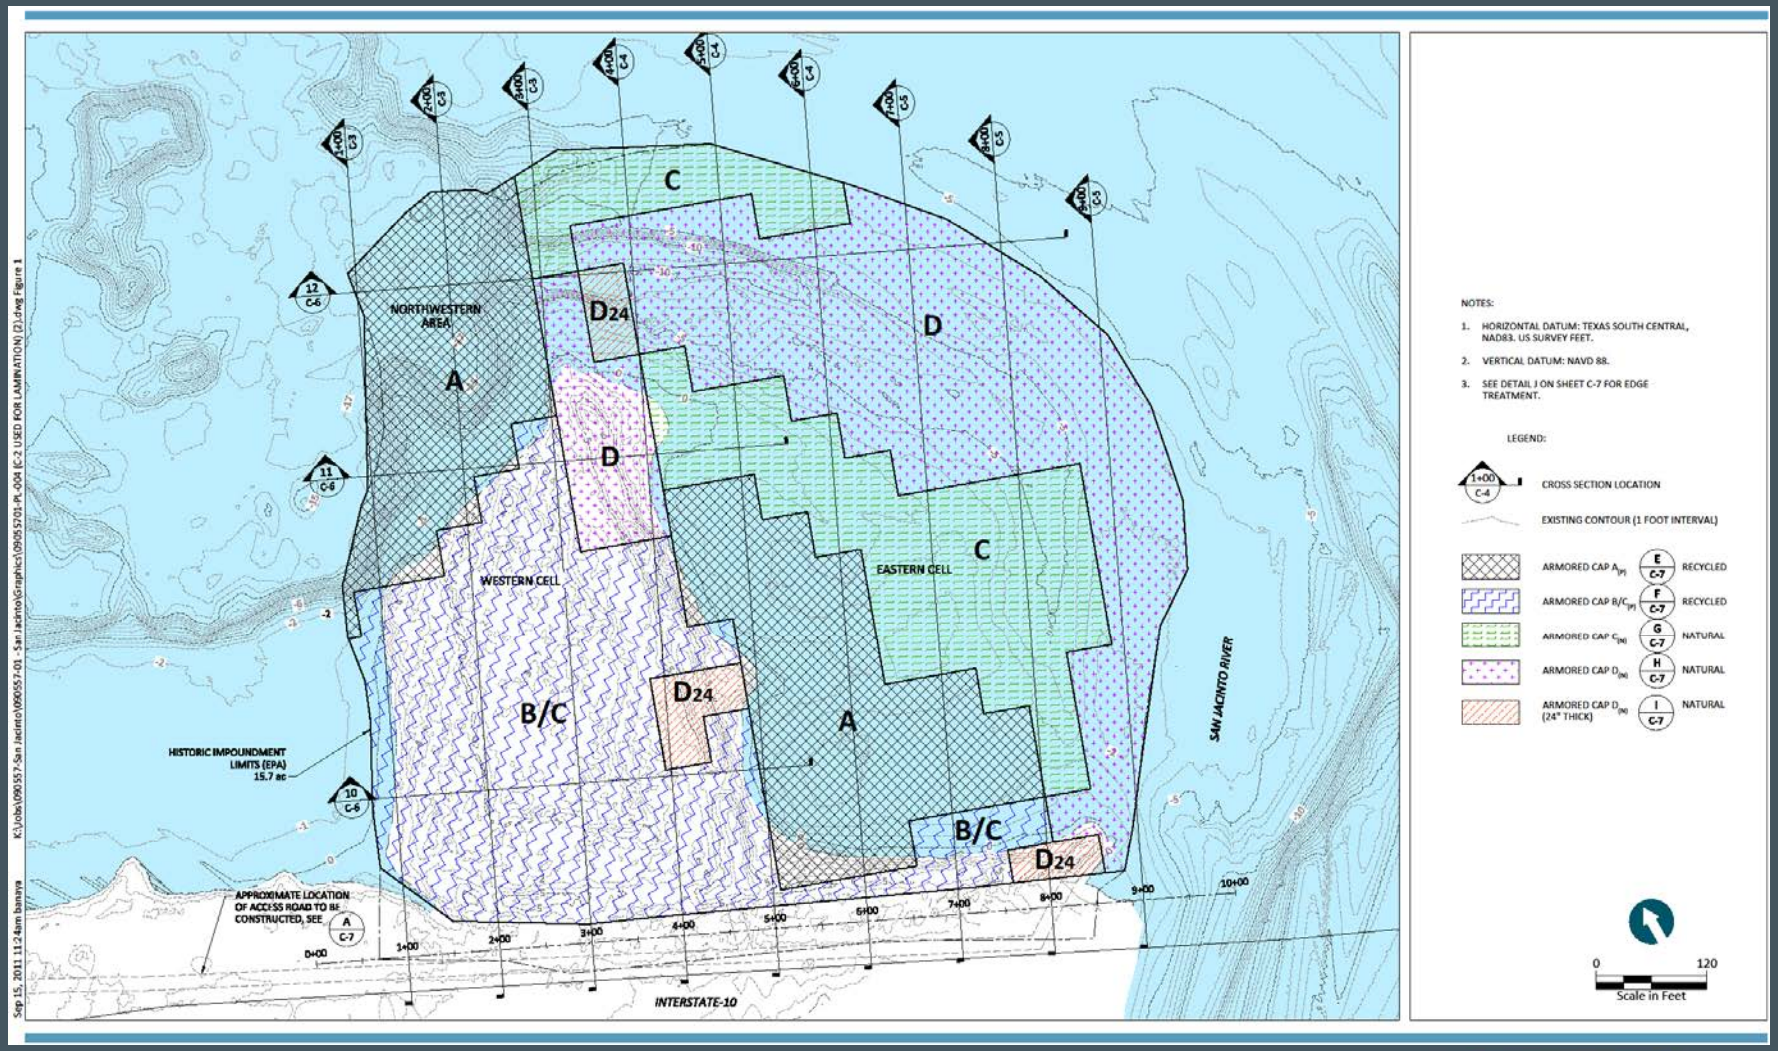

Geomembrane Placement

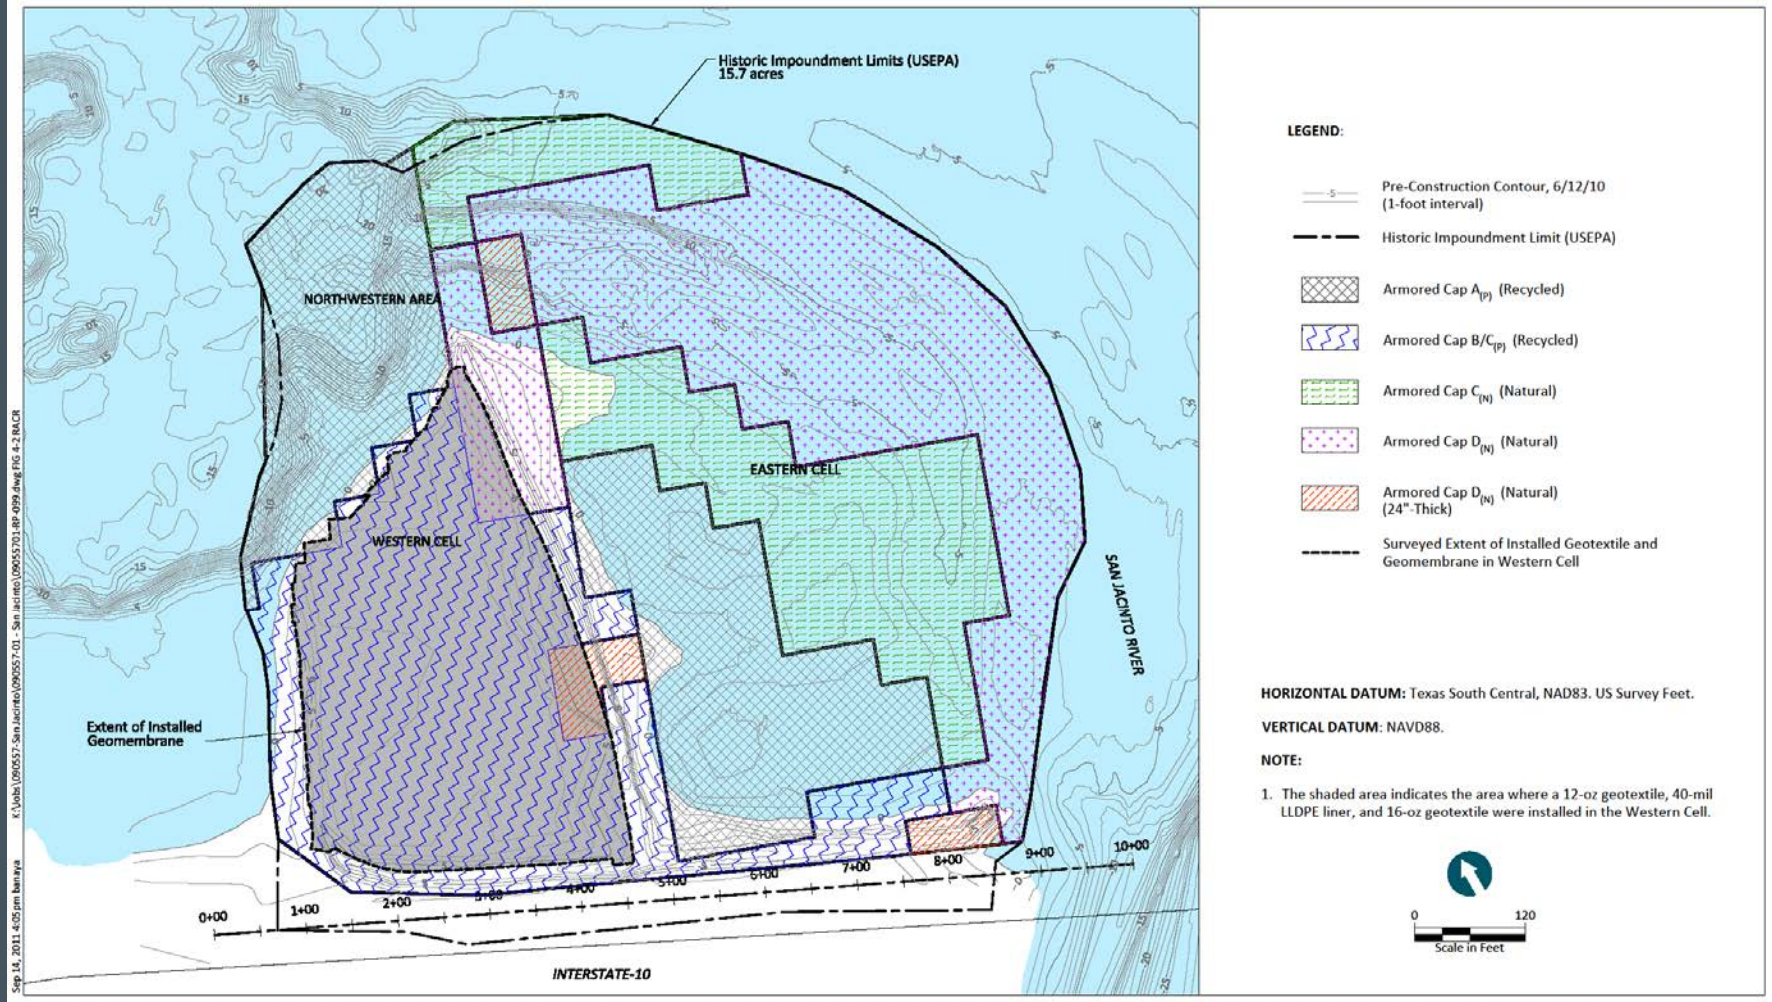

Armor Cap Types A and B/C

Armored Cap A

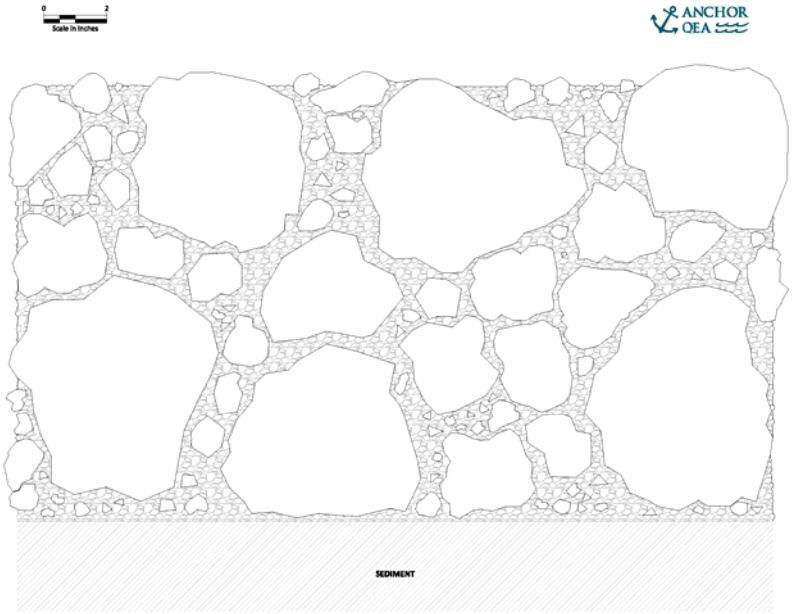

12 inch min.

Armored Cap B/C

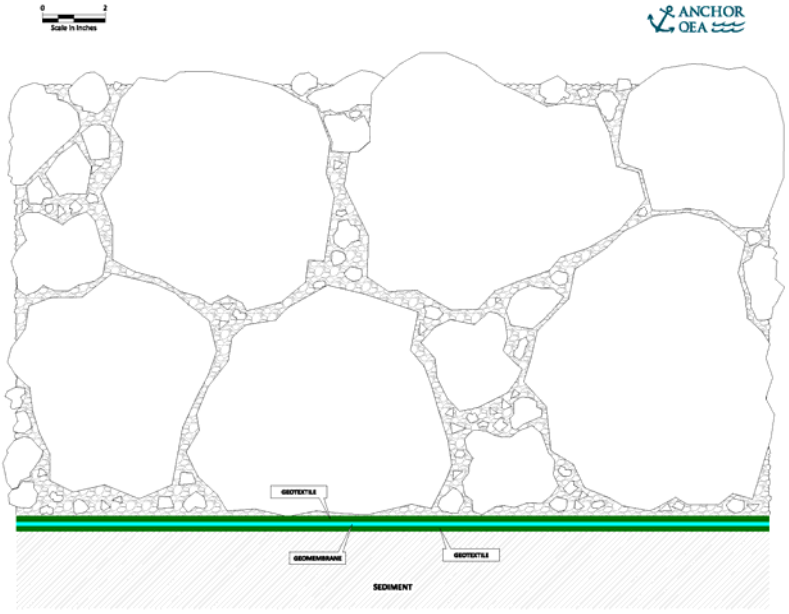

ANCHOR QEA

Armor Cap Types C and D

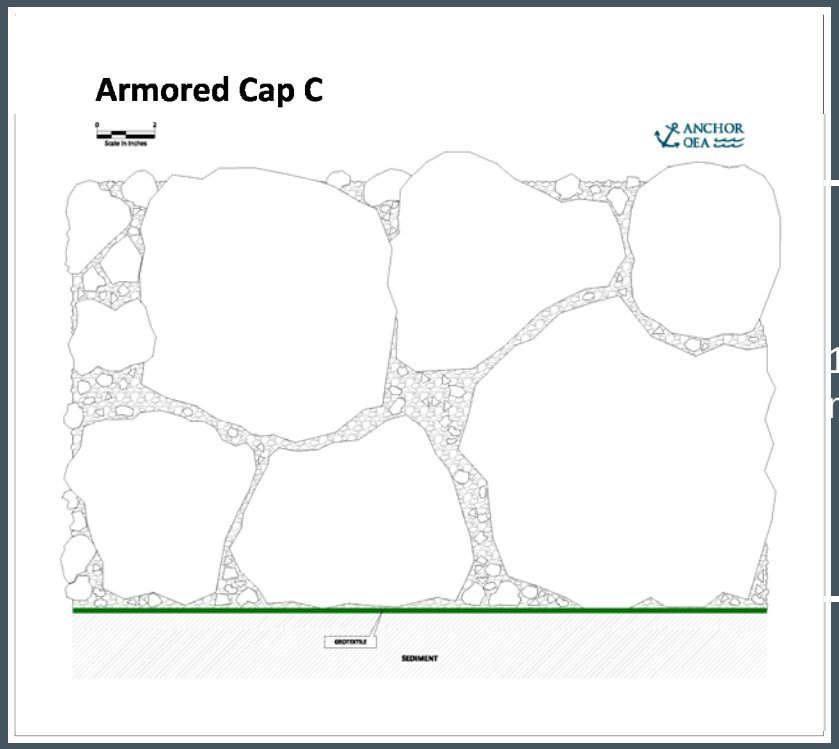

12 inch min.

18 inch min.

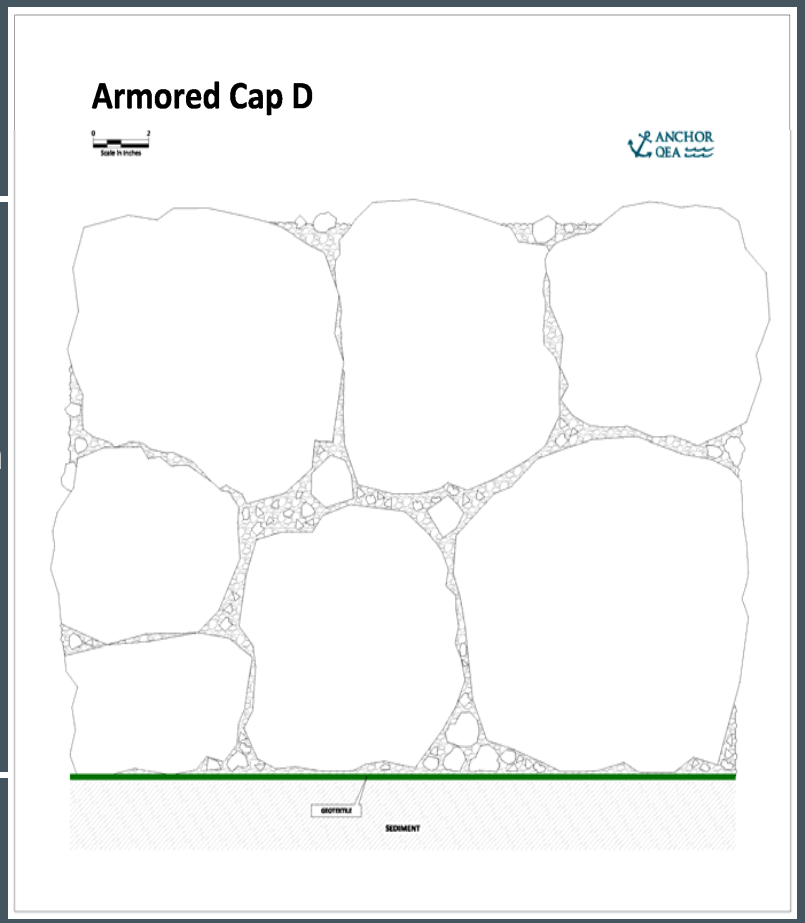

ANCHOR QEA

Armor Cap Type D-24

24 inch min.

Waterside Armor Cap Placement

Placement of Armor Cap D Material on Eastern Cell

Placement of Armor Cap D and Geotextile Material on Eastern Cell

ANCHOR QEA

Western Cell Construction

Waste Solidification

Geotextile, Geomembrane and Rock Placement

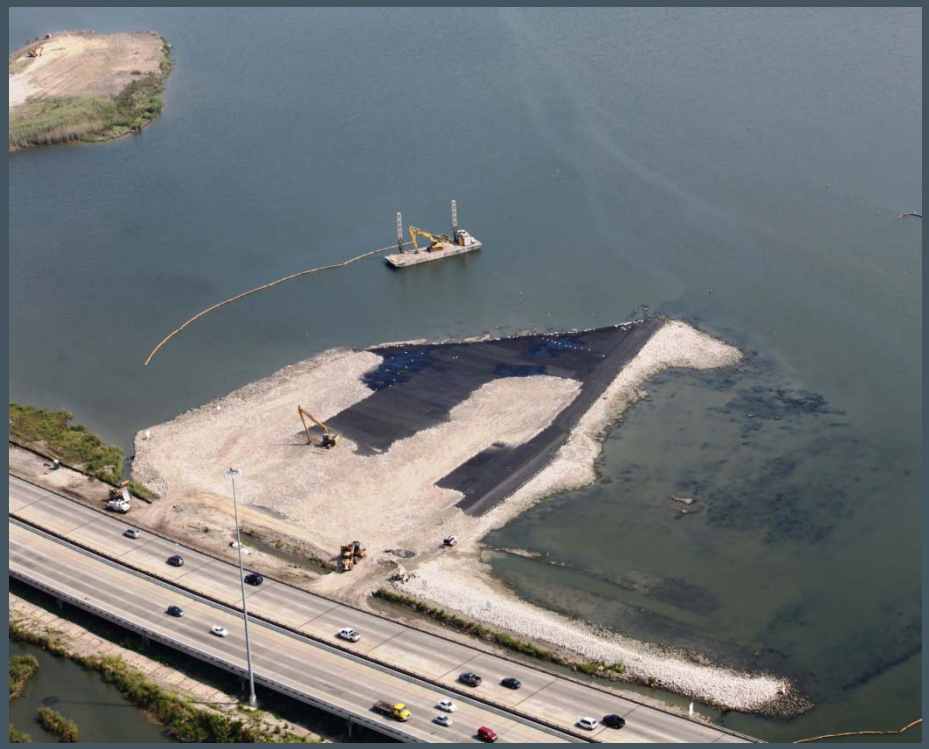

ANCHOR QEA

Construction Verification

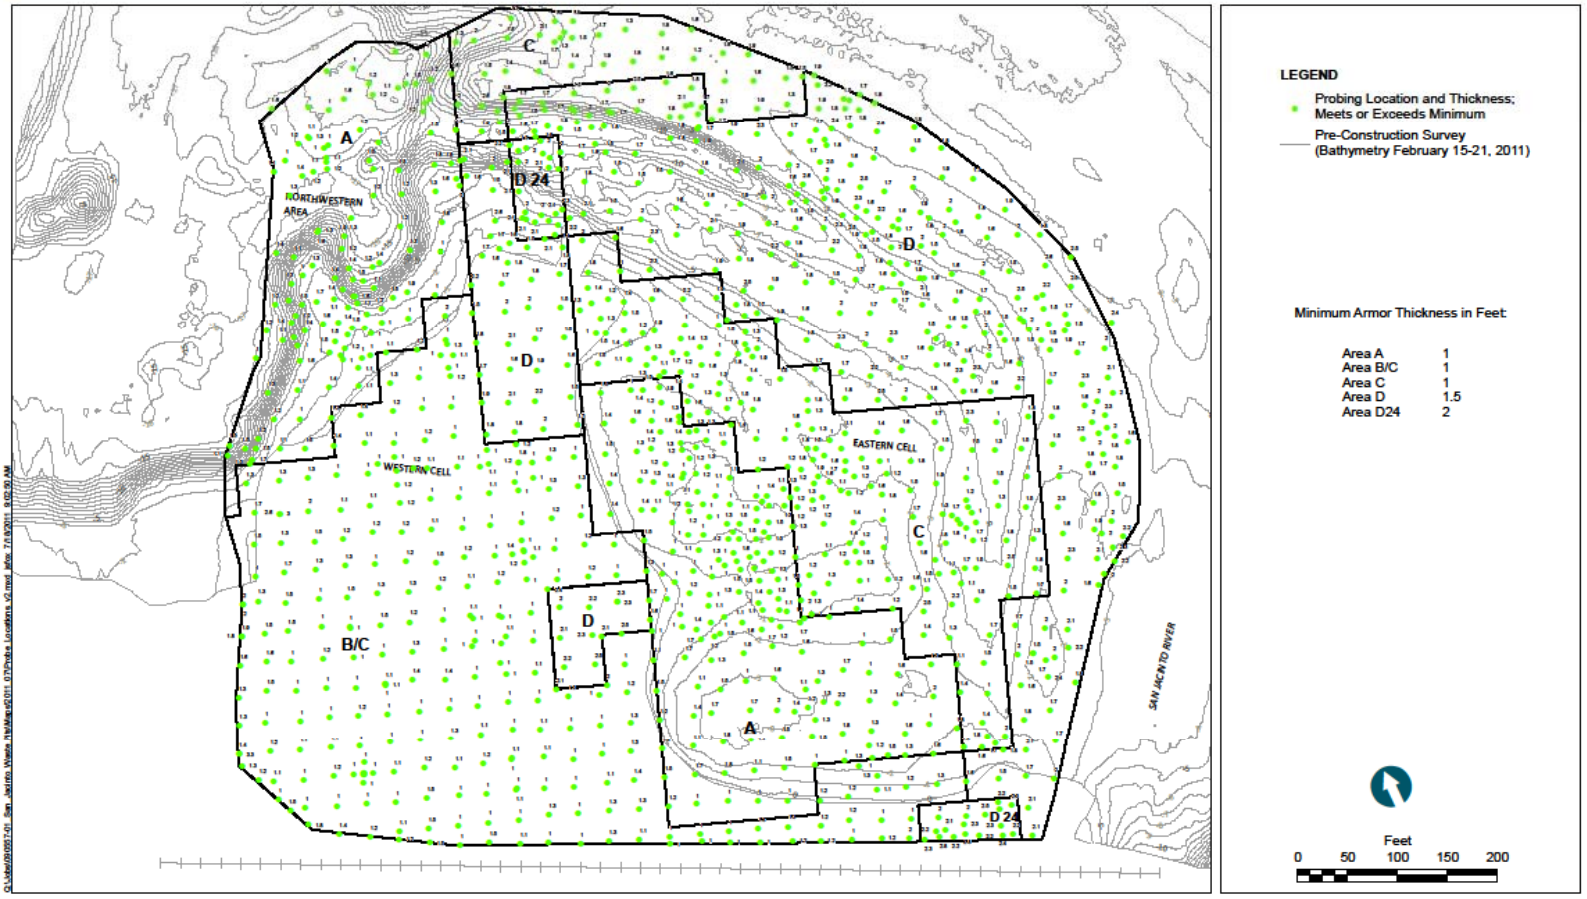

Completed Cap (July 14, 2011)

ANCHOR QEA

Armored Cap Benefits

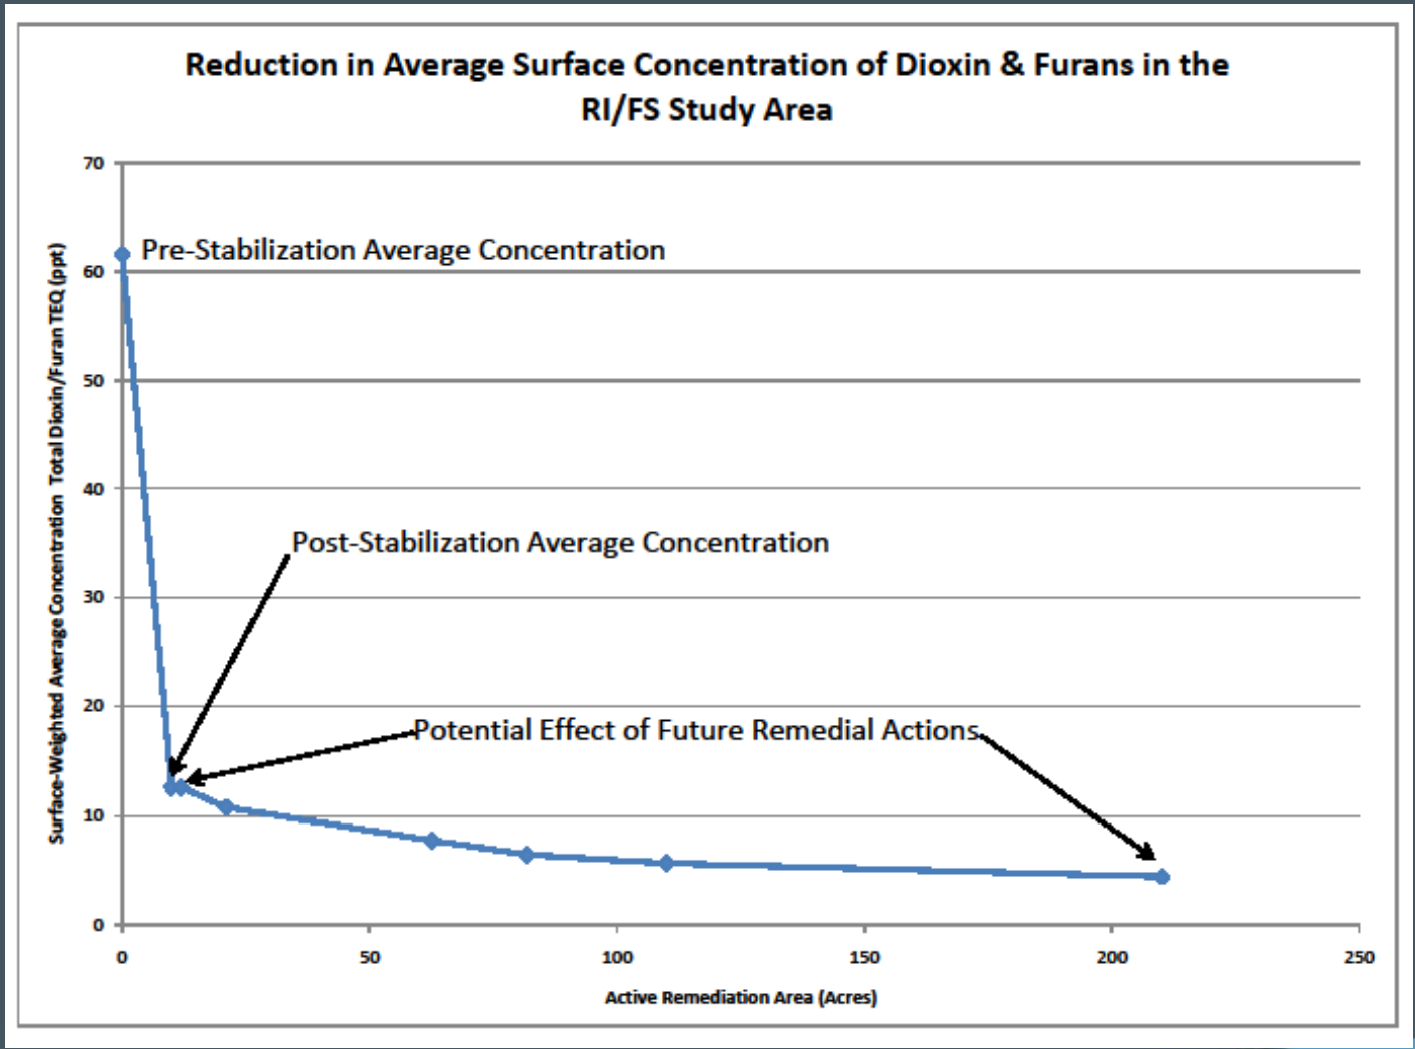

ANCHOR QEA

Monitoring and Maintenance

- 5,700 linear feet of perimeter fence
- 15 warning signs
- 59,000 tons of armored cap rock
  - 15.7 acre area
  - Approximately 3.2 acres in Western Cell

ANCHOR QEA

Monitoring Schedule

- Quarterly, Semi-Annually, Annually
- Following major flow events

Interval	Schedule
Baseline Bathymetric and Topographic Survey	August 2011
Quarterly	January 2012
	April 2012
	July 2012
	October 2012
	January 2013
	April 2013
	July 2013
	December 2013

Interval	Schedule
Semi-Annually	April 2014
	October 2014
	April 2015
	October 2015
	April 2016
	October 2016
Annually	Each July beginning in 2017
25-Year Flow Event	Following first such event
100-Year Flow Event	Following each such event

ANCHOR QEA